




SUPERLINEA SOSPENSIONE STANDALONE

CODE 723 --


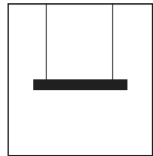


cod 72350-


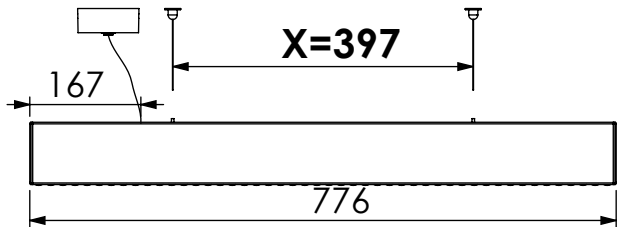


7235-----O	LED		IP40		ON/OFF
7235-----D	LED		IP40		DALI
7235-----S	LED		IP40		PUSH
7235-----C	LED		IP40		CASAMBI



cod 72351-

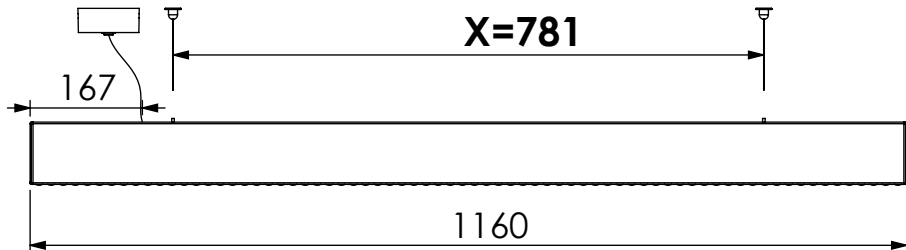

DIRECT
CODE 723 5-U (UP)
CODE 723 5-D (DOWN)

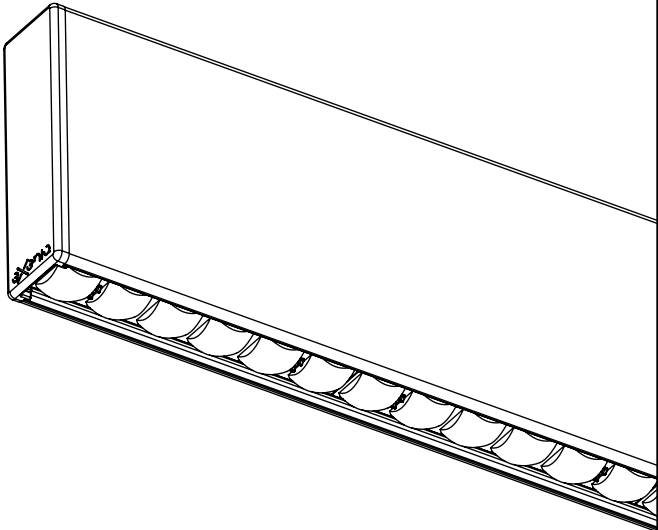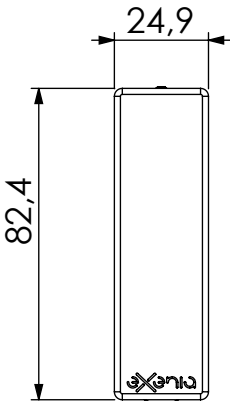



cod 72352-

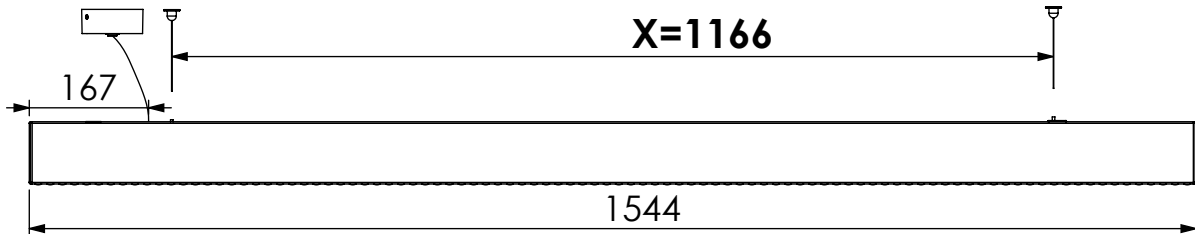




DIRECT-INDIRECT
CODE 723 5-UD (UP+DOWN)

cod 7235-

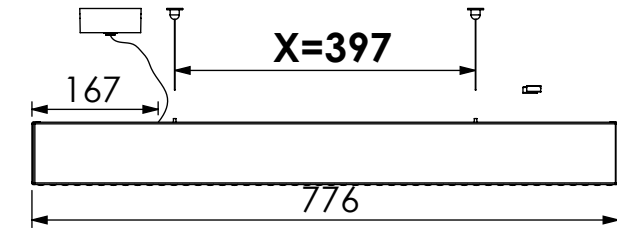


7235-----O	LED		IP40		ON/OFF
7235-----D	LED		IP40		DALI
7235-----S	LED		IP40		PUSH
7235-----C	LED		IP40		CASAMBI

cod 7235-

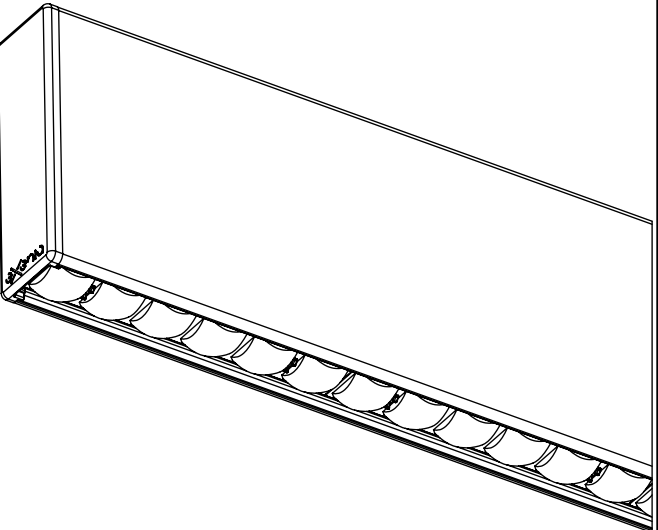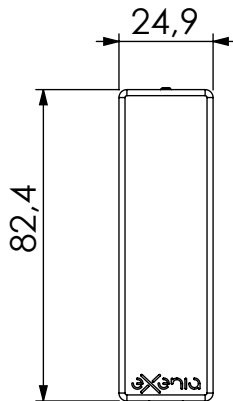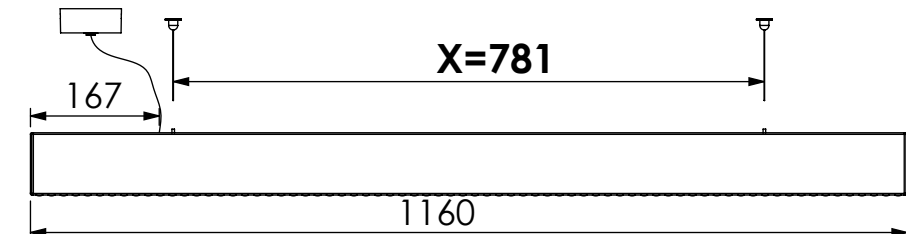

cod 7235-

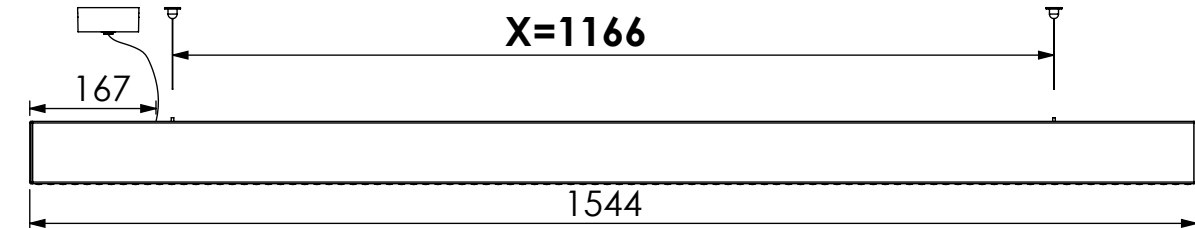


LED



2x 2x
NOT INCLUDED


2

3

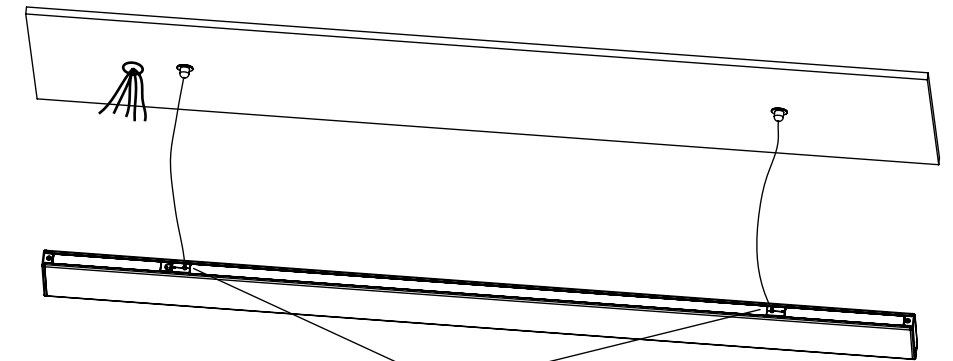

4


5

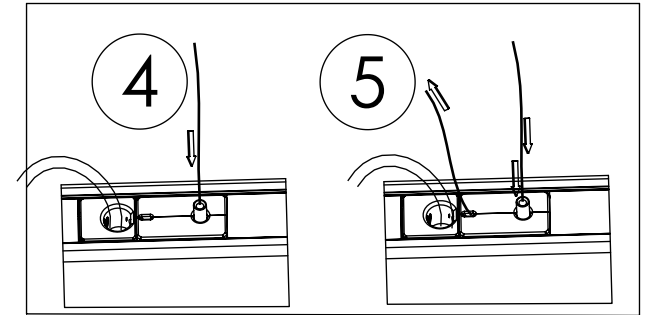

1

1

9

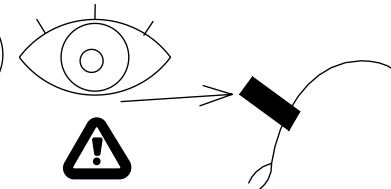

L
MARRONE
BROWN



N
BLU
BLUE

8

10




SEC


7

SEC

12


11

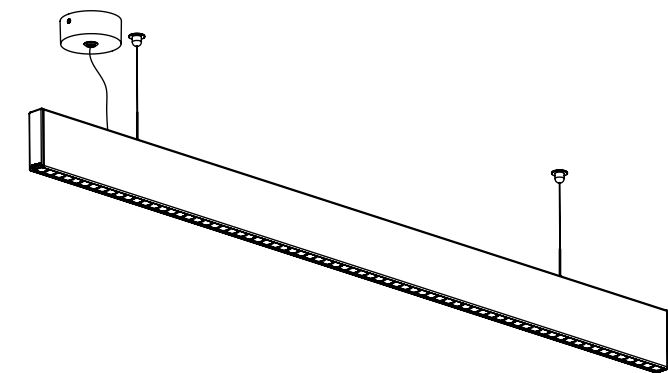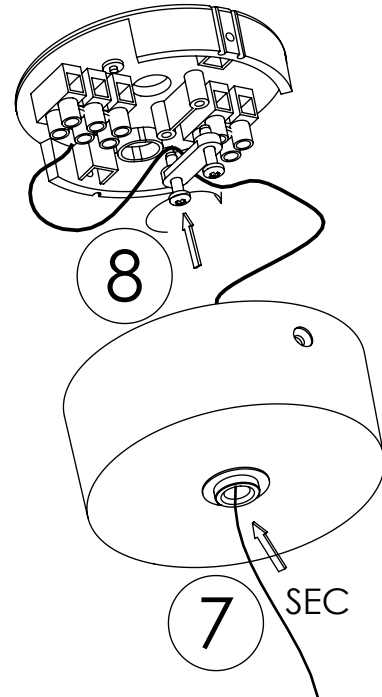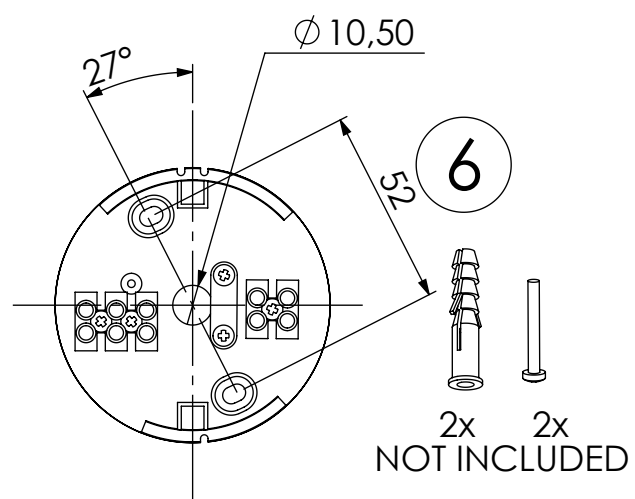

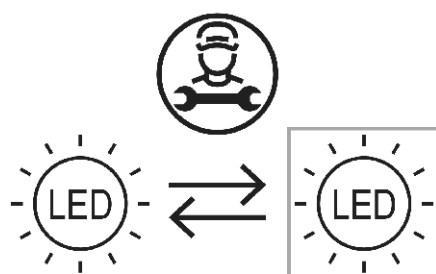

I:LA SOSTITUZIONE DELLA SORGENTE LUMINOSA, PUO' ESSERE ESEGUITA SOLO FACENDO RIENTRARE IL PRODOTTO IN EXENIA O DA SUO CENTRO DI ASSISTENZA AUTORIZZATO.

GB:THE LIGHT SOURCE REPLACEMENT, CAN BE DONE ONLY TO RETURNED THE PRODUCT IN EXENIA OR FROM ITS AUTHORIZED SERVICE CENTRE.

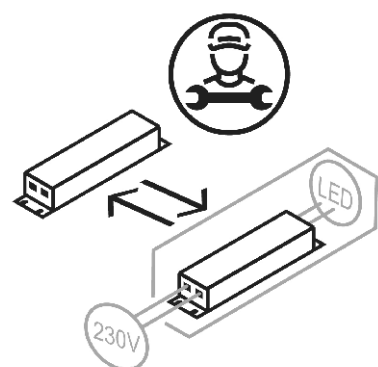

I:LA SOSTITUZIONE DEL DRIVER, PUO' ESSERE ESEGUITA SOLO FACENDO RIENTRARE IL PRODOTTO IN EXENIA O DA SUO CENTRO DI ASSISTENZA AUTORIZZATO.

GB:THE DRIVER REPLACEMENT, CAN BE DONE ONLY TO RETURNED THE PRODUCT IN EXENIA OR FROM ITS AUTHORIZED SERVICE CENTRE.

